

Date: Wednesday, 13/08/2008 10:10:04 AM
 User: Julie Lecocq

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : AFT TUBE ASSEMBLY
 Job Number : 41191
 Estimate Number : 10699
 P.O. Number :
 This Issue : 13/08/2008 S.O. No. :
 Prsht Rev. : NC Part Number : D3391025
 First Issue : 1/1 Type : SKIDTUBES Drawing Number : D3391 REV G
 Drawing Revision : G
 Previous Run : 41190 Material :
 Due Date : 28/08/2008 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : JLD 08.8.13
 Comment : Est Rev B 06-02-07 ECN773 dwg rev. D EC
 Est Rev:C 06-03-28 Update Manuf. Instructions JLM
 est rev D 07.03.20 revF dwg EC
 est rev E 07.11.07 rev G dwg ecn 1053p EC verified by:
 DD
 Est Rev:F 07-11-13 ECN 1056 DD verified by: EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 D6014090 ALUMINUM EXTRUSION



Comment: Qty.: 1.0000 f(s)/Unit Total : 1.0000 f(s)

ALUMINUM EXTRUSION

Pick:

Qty. Part Number Description Batch

1 D6014-090 Extrusion B32309

Identify as D3391-3

08.08.13 (1)

2.0 MORI SEIKI MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

Turn as per Folio FA599

Rev: AA & Dwg D3391 Rev: G

08.08.13 (1)

3.0 QC2 INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

08/08/21 (10)

4.0 HAAS1 HAAS CNC VERTICAL MACHINING #1



Comment: HAAS

1-Machine as per Folio FA 599 Rev: AA & Dwg D3391 Rev: G

2-Deburr

08/09/02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:04 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41191

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

26 08/09/03

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

26 08/09/03

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill (PILOT HOLE) aft cap holes per Dwg D3391 using DT8803

25 08-09-04

8.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: NC Bender

Form as per Dwg D3391 Using Bend Prog 3391025

25 08-09-04

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

25 08/09/04

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Aft cap pilot hole to .208" as per Dwg D3391

2-Drill float bag holes using DT8809 as per Dwg D3391(Holes marked "A" Only.

3-Drill wearplate holes as per Dwg D3391 using DT8878(Mid Tube) & DT8217 Wearplate Jig .

*****Do Not Open To Finished Size*****

4-Drill Wearshoe holes as per DWG D3391 using DT8939 locating from 2 previously drilled aft wearplate holes.

5-Open wearplate holes to 0.250" and c'bore as per dwg D3391

6-Open up all wearshoe , wearplate to 0.297"and float bag holes to 0.328" as per Dwg D3391.

7-Deburr

Tools: rill

M
2-9-8

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:04 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41191

Part Number: D3391025

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

11.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

See 09/05 @

12.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1
Acid etch and Alodine as per QSI 005 4.1

AWM 8-9-9

13.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION
------	-----	---



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D M 7-9-9

14.0	D36704200	SPACER
------	-----------	--------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)
SPACER
batch: B 36818

④

M 7-9-9

15.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
------	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1
Instal spacers as per dwg D3391

A/R Magnabond 6398 Batch: M102966
exp. date: 12/08/09-10-1
cure time 12hrs as per QSI0015

M 7-9-9

16.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

See 09/05 @

17.0	POWDER COATING	POWDER COATING
------	----------------	----------------



Comment: POWDER COATING
Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 11 108523

START TIME: 2:00 PM
OVEN TEMPERATURE: 320°F
FINISH TIME: 2:30 PM

HL

09-09-15

Ⓢ

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:04 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41191

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

m-d 08/09/16 (IX)

19.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Aft Cap

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap

B41435 *m-d*

20.0

D35371

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD

B38941 *m-d*

21.0

D35377

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearpad

B33869 *m-d*

22.0

D35531

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

B33868 *m-d*

23.0

D35533

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket

B33870 *m-d*

24.0

D36721

Phenolic Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

PHENOLIC WASHER

B39275 *m-d*

25.0

ALS41032130

Insert



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

INSERT

batch: M105819

(IX) *m-d* 08/09/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:04 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41191

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

or equivalent per
QSI 017

26.0

ALS41032225

Insert



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

INSERT

or equivalent

Per QSI 017

M106489

M-1

27.0

AN3C4A

BOLT



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Bolt

Pick:

Qty	Part Number	Description	Batch
2	AN3C4A	Bolt	

M109148

M-1

28.0

AN3C5A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

M108744

M-1

29.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Inventory

Pick:

Qty	Part Number	Description	Batch
2	AN960C10L	Washer	

M108255

M-1

30.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1

1-Install inserts as per Dwg D3391

2-Install Aft Cap as per Dwg D3391

A/R Sikaflex-241/-291

Sikaflex expiry date:

M108801

08/10

M-1 08/09/16

(IX)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:04 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41191

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

31.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 08/11/20 (40)

32.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: PPD 41688

FINAL INSPECTION/W/O RELEASE

33.0

QC21



Comment: FINAL INSPECTION/W/O RELEASE

08/11/26 J

Job Completion



mf 08-11-26


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

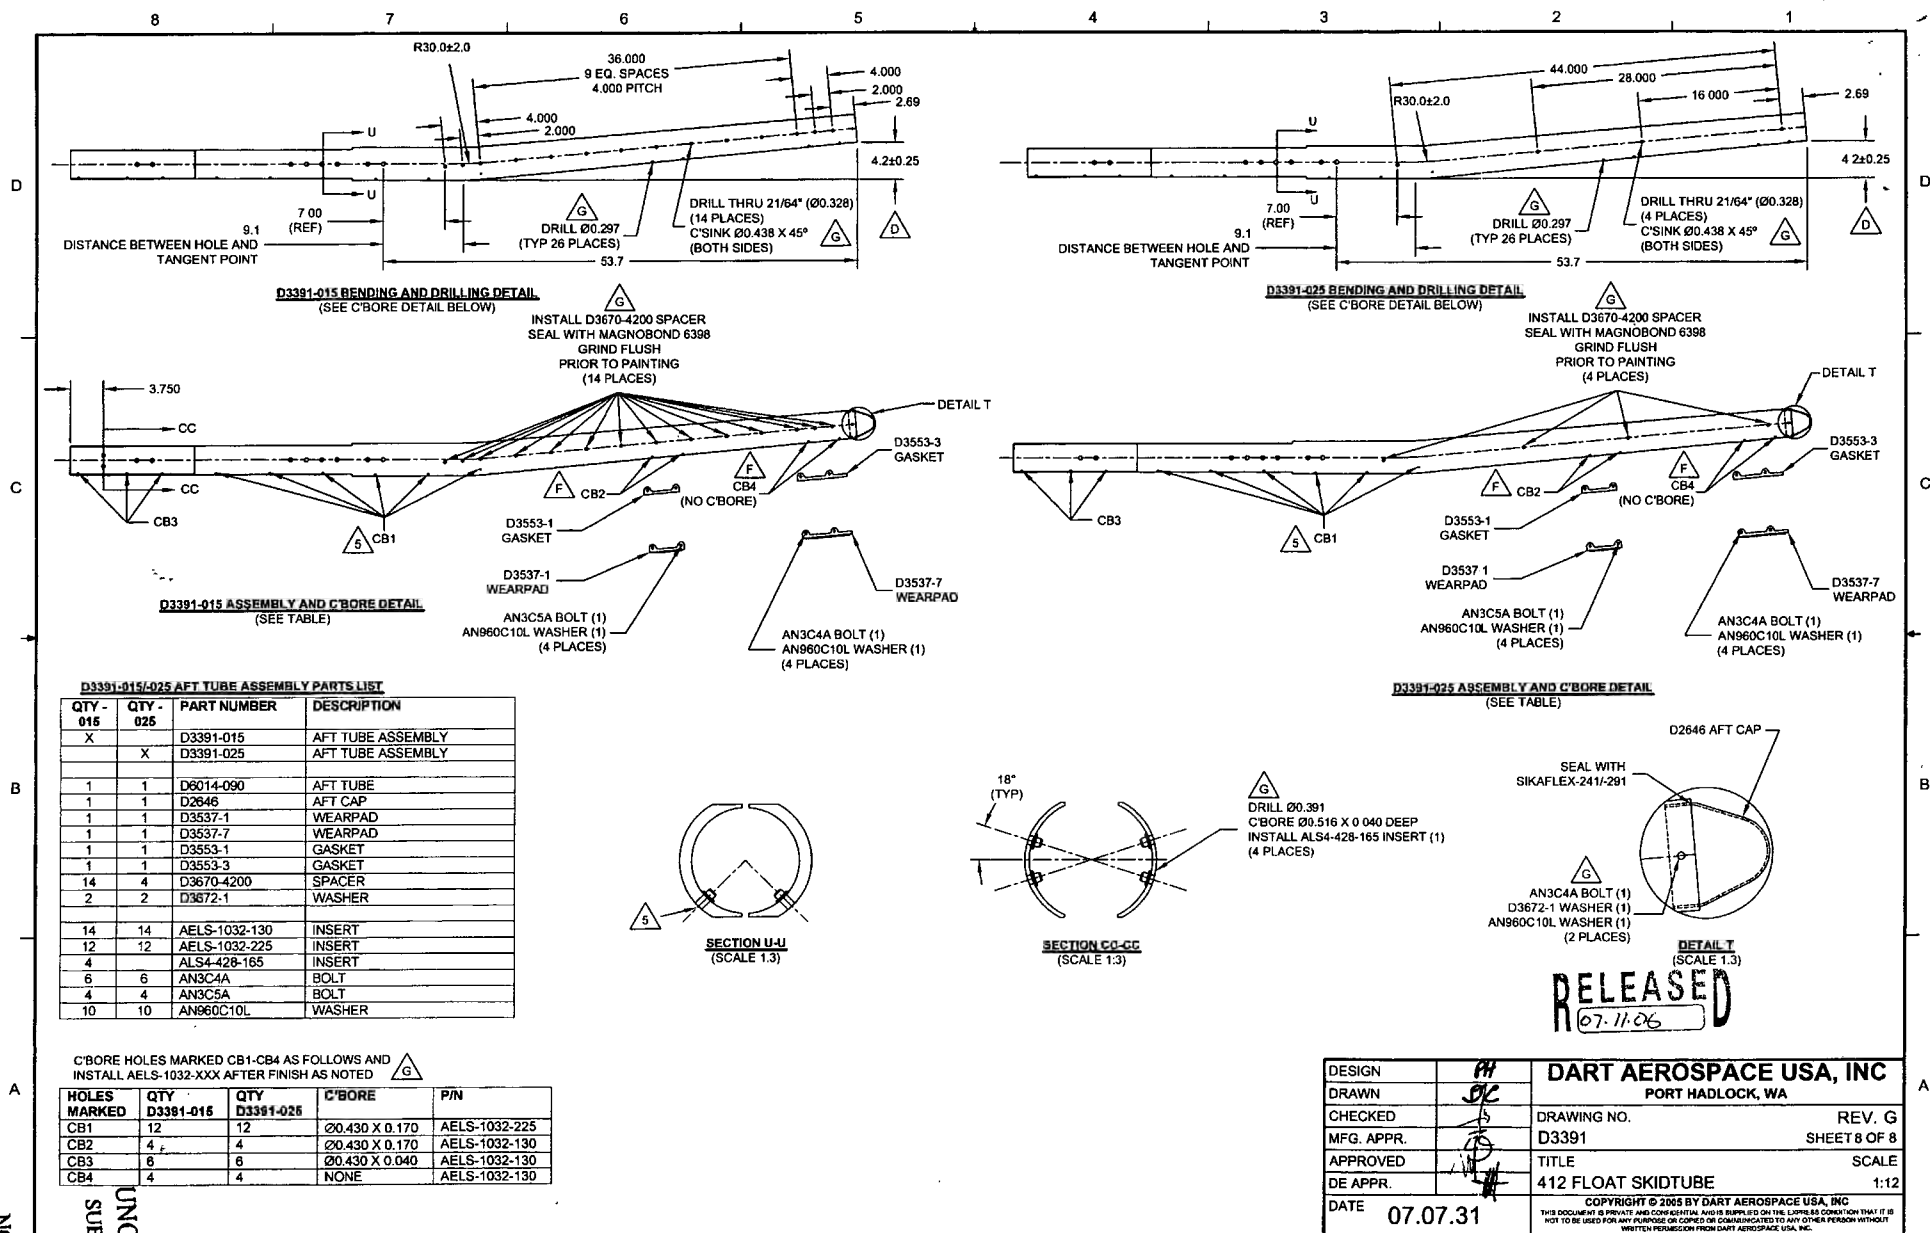

NO. 4117

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

DART AEROSPACE LTD		Work Order: 4191
Description: Float Skidtube (412)		Part Number: D3391-3
Inspection Dwg: D3391	Rev: G	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
14.000	+/-0.010	14.000	/			
3.500	+/-0.010	3.503	/			
88.93	+/-0.030	88.930	/			
44.995	+/-0.030	44.995	/			
3.200	+/-0.010	3.204	/			
1.526	+0.000/-0.030	1.518	/			
0.200	+/-0.010	.195	/			
7.500	+/-0.010	7.510	/			
27.750	+/-0.010	27.760	/			
31.750	+/-0.010	31.750	/			
35.250	+/-0.010	35.260	/			
3.300	+/-0.010	3.295	/			
0.200	+/-0.010					
3.520	+/-0.010	3.518	/			
0.687	+0.010/-0.000	.687	/			
R0.062	+/-0.010	.062	/			
Ø0.484	+0.005/-0.001	.488	/			

Measured by: A.M. / S.B.	Audited by: 120	Prototype Approval:	N/A
Date: 08.08.21	Date: 08/09/03	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	06.04.24	New Issue P/O D3391-015/-025	KJ/JLM	
B	06.06.19	Dwg revision update	KJ/JLM	
C	07.04.20	Ø0.208 dimension removed	KJ/JLM	
D	07.09.06	0.400 dimension removed	KJ/JLM	
E	07.11.23	Dwg Rev. updated	KJ/EC/DD	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

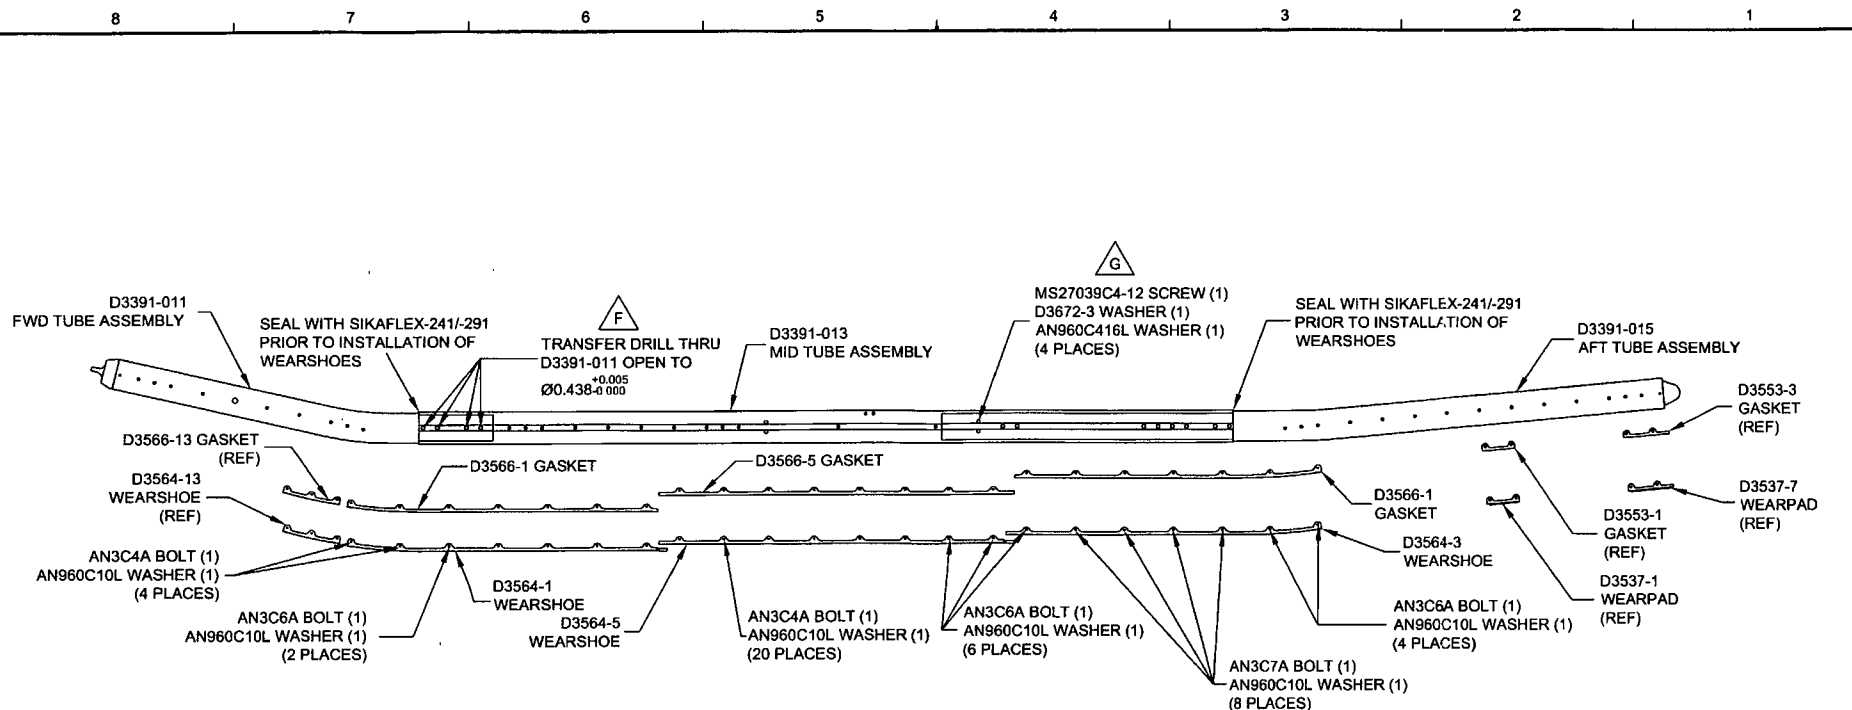

D3391-041 ASSEMBLY

RELEASED
07-11-06

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
12	AN3C7A	BOLT
12	AN960C10L	WASHER
12	MS27039C4-12	SCREW
12	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C-BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.07.31		


DART AEROSPACE USA, INC
PORT HADLOCK, WA

DRAWING NO. D3391
REV. G
SHEET 1 OF 8

TITLE
412 FLOAT SKIDTUBE
NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC

NO. 117
WORK ORDER
RETURN TO
ENGINEERING
FOR COPY
UNCONTROLLED COPY
NOT TO BE USED
WITHOUT NOTICE
TO AMENDMENT

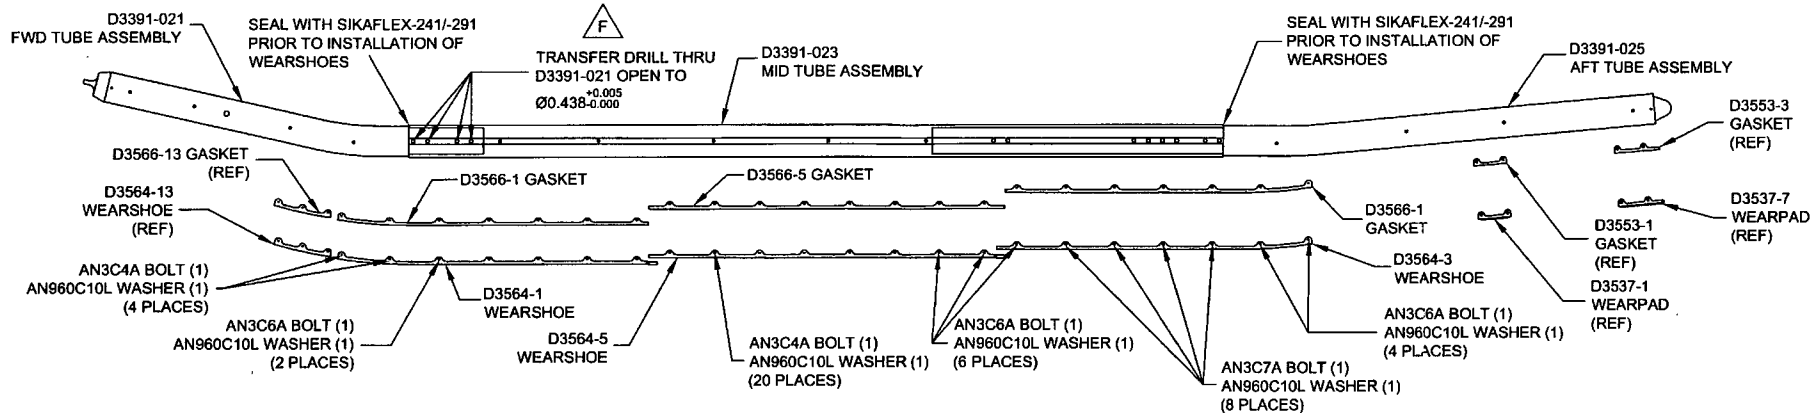

D3391-043 ASSEMBLY

RELEASED
07.11.97

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DESIGN		DART AEROSPACE USA, INC	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	SLC	DRAWING NO.	REV. G
MFG. APPR.	h	D3391	SHEET 2 OF 8
APPROVED	h	TITLE	SCALE
DE APPR.	h	412 FLOAT SKIDTUBE	NTS
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. WHOEVER SUPPLIED ON THE EXPRESS OR IMPLIED OR THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


NO 44197
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOP COPY
UNCONTROLLED COPY

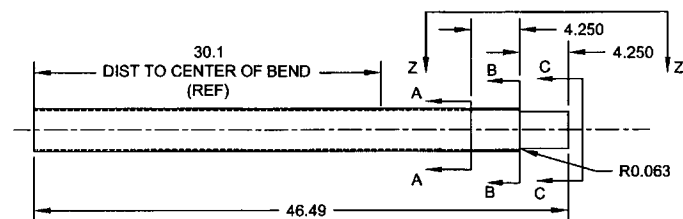


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

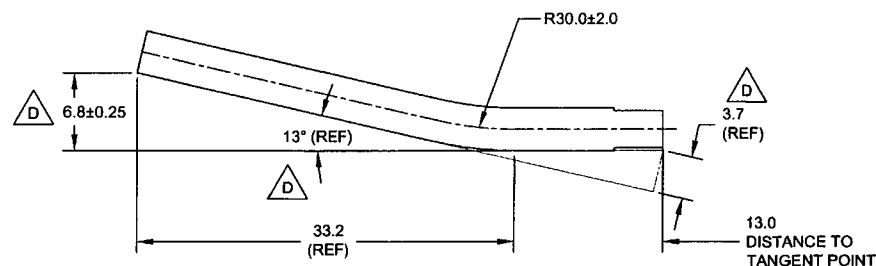


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

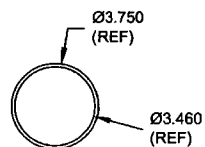


SECTION A-A
(SCALE 1:5)

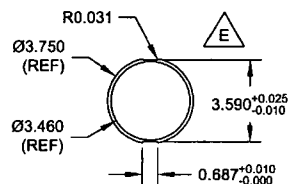

SECTION B-B
(SCALE 1:5)

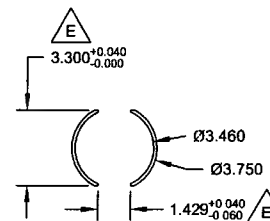

SECTION C-C
(SCALE 1:5)

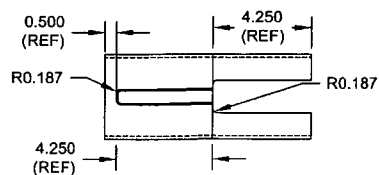


VIEW Z-Z
(SCALE 1:5)

RELEASED
07-11-08


NO WORK ORDER
WITHOUT NOT CE
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
ENGINEERING
RETURN TO
SHOP COPY

DESIGN		DART AEROSPACE USA, INC	
DRAWN	JLC	PORT HADLOCK, WA	
CHECKED		DRAWING NO. D3391	REV. G
MFG. APPR.		SHEET 3 OF 8	
APPROVED		TITLE SCALE	
DE APPR.		412 FLOAT SKIDTUBE 1:10	
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	






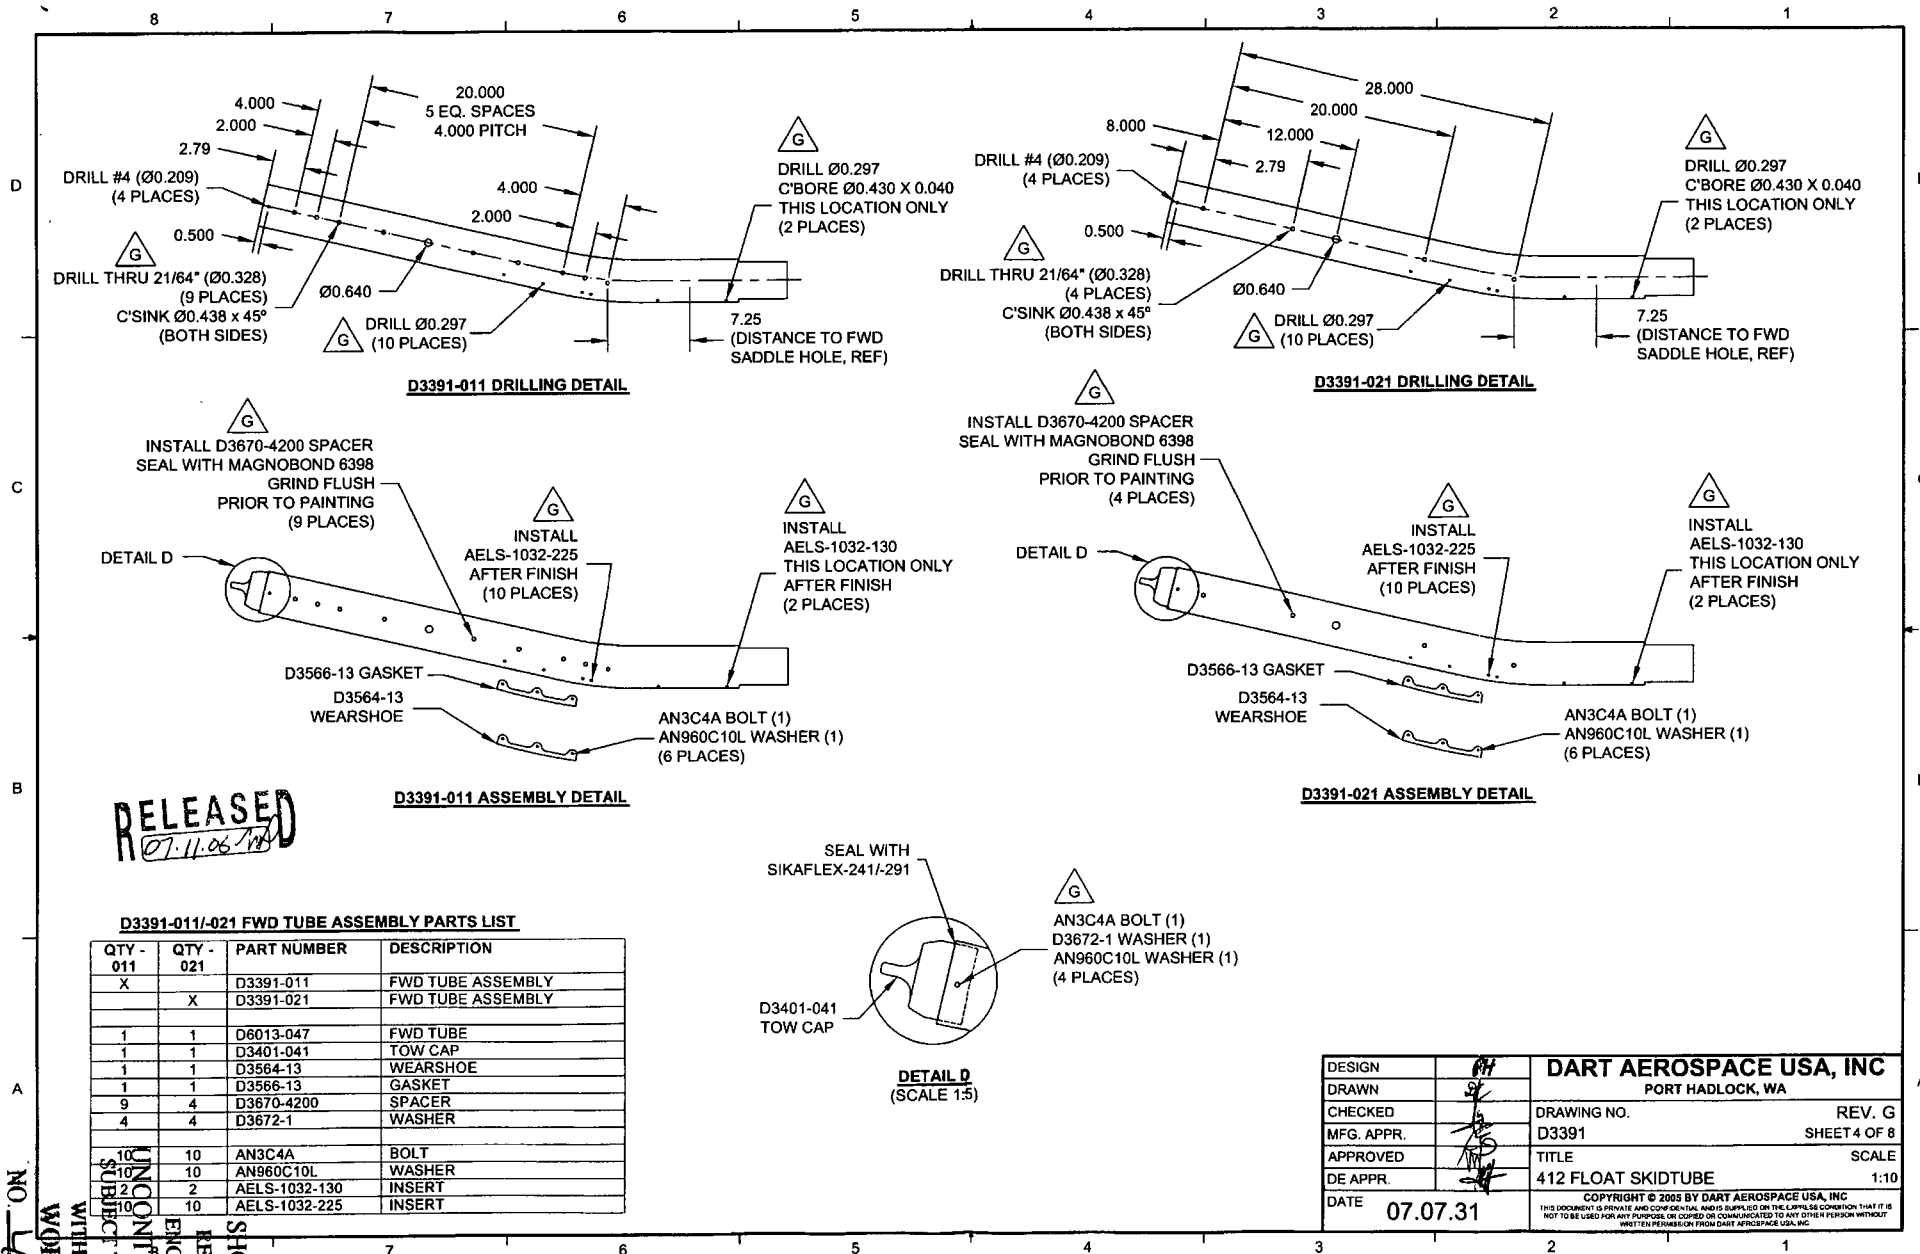


RELEASED
07.11.06



NO. 41191
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
ENGINEERING
RETURN TO
SHOP COPY

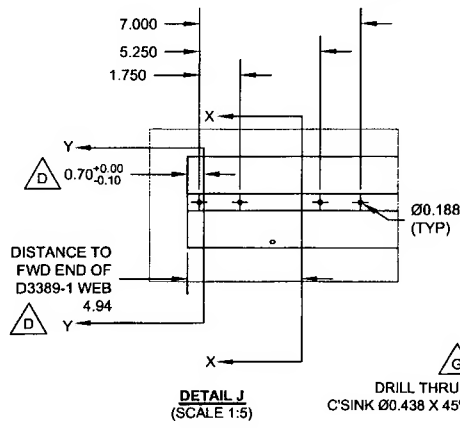

DRILL THRU 21/64" (Ø0.328)
C'SINK Ø0.438 X 45° (BOTH SIDES)
(12 PLACES)

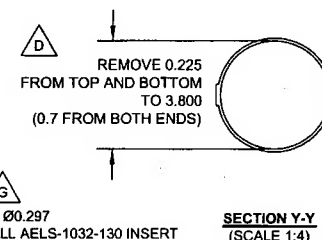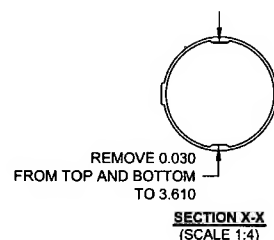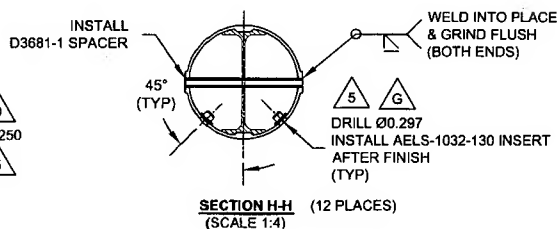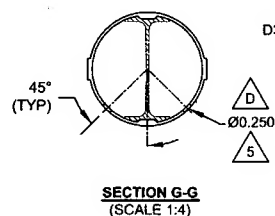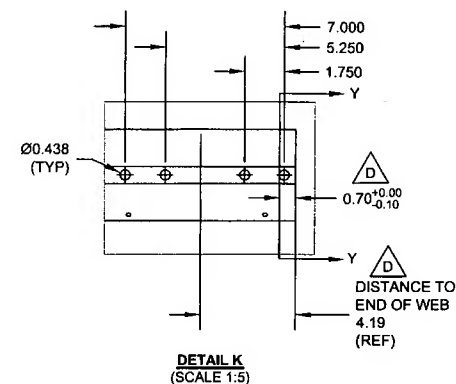
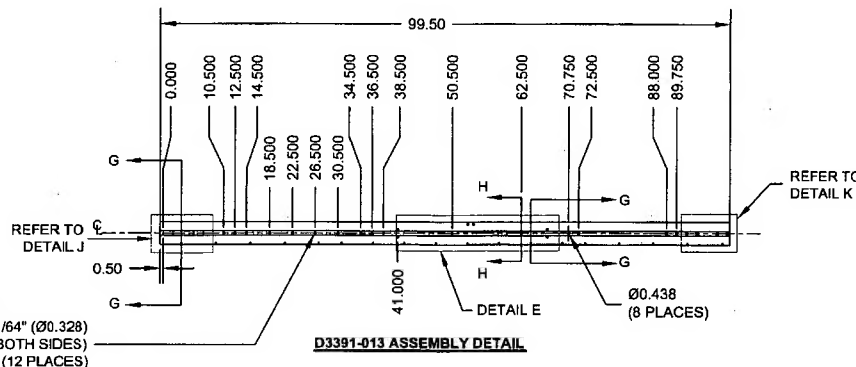


DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
(TYP 4 PLACES)

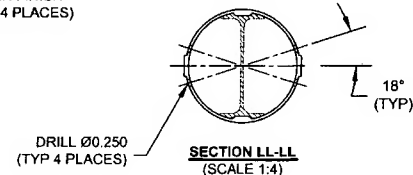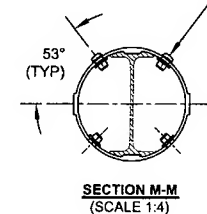

D3391-013 MID TUBE ASSEMBLY PARTS LIST



QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
12	D3681-1	SPACER
4	D3672-1	WASHER
4	D3672-3	WASHER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

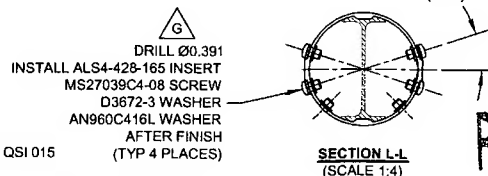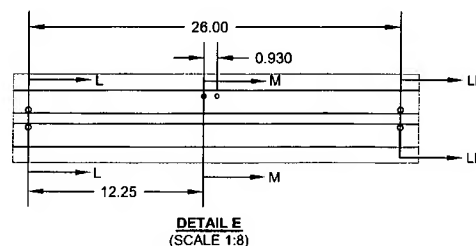


DESIGN	HA	DART AEROSPACE USA, INC
DRAWN	DE	PORT HADLOCK, WA
CHECKED	DE	DRAWING NO. D3391
MFG. APPR.	DE	REV. G SHEET 5 OF 8
APPROVED	DE	TITLE 412 FLOAT SKIDTUBE
DE APPR.	DE	SCALE 1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

RELEASED
07.11.06


NO WORK ORDER
WITHOUT NOTICE
TO AMENDMENT
UNLESS RETURNED TO
ENGINEERING
FOR CONTROLLED COPY
FOR COPY

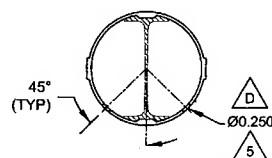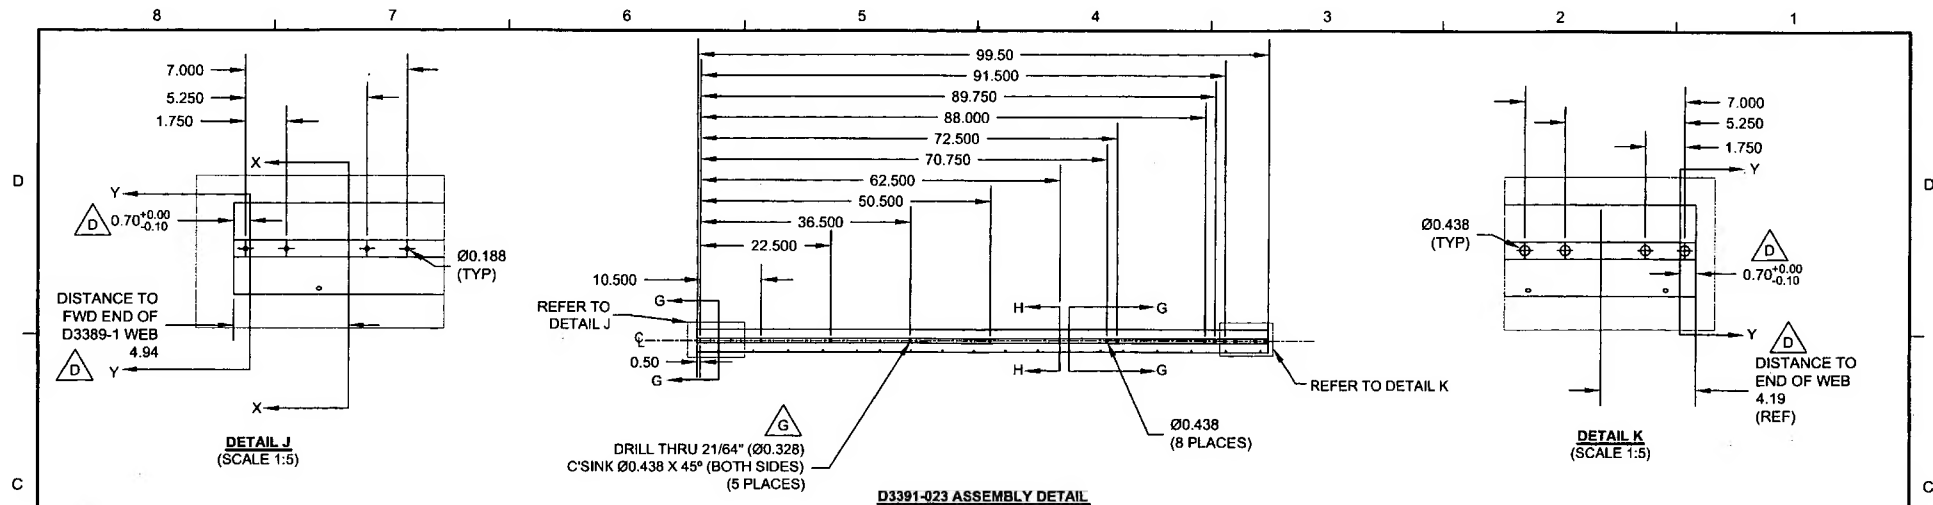


SECTION G-G
(SCALE 1:4)

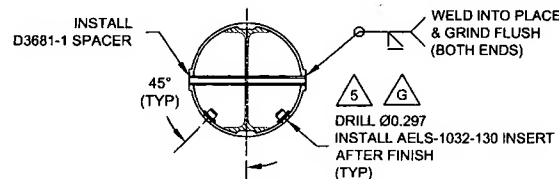

SECTION H-H
(SCALE 1:4)

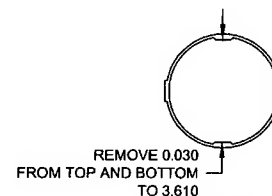

SECTION X-X
(SCALE 1:4)

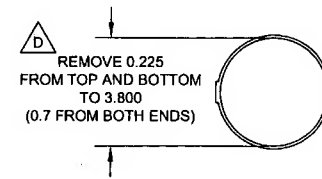

SECTION Y-Y
(SCALE 1:4)

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY


MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
INSTALL D3681-1 SPACER PER DART QSI 004

RELEASED
07-11-06

DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	DE	PORT HADLOCK, WA
CHECKED	DE	DRAWING NO. D3391
MFG. APPR.	DE	REV. G
APPROVED	DE	SHEET 6 OF 8
DE APPR.	DE	TITLE SCALE
DATE	07.07.31	412 FLOAT SKIDTUBE 1:20

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE, AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
NOT TO BE AMENDED
WITHOUT NOTICE
WORK ORDER
411197

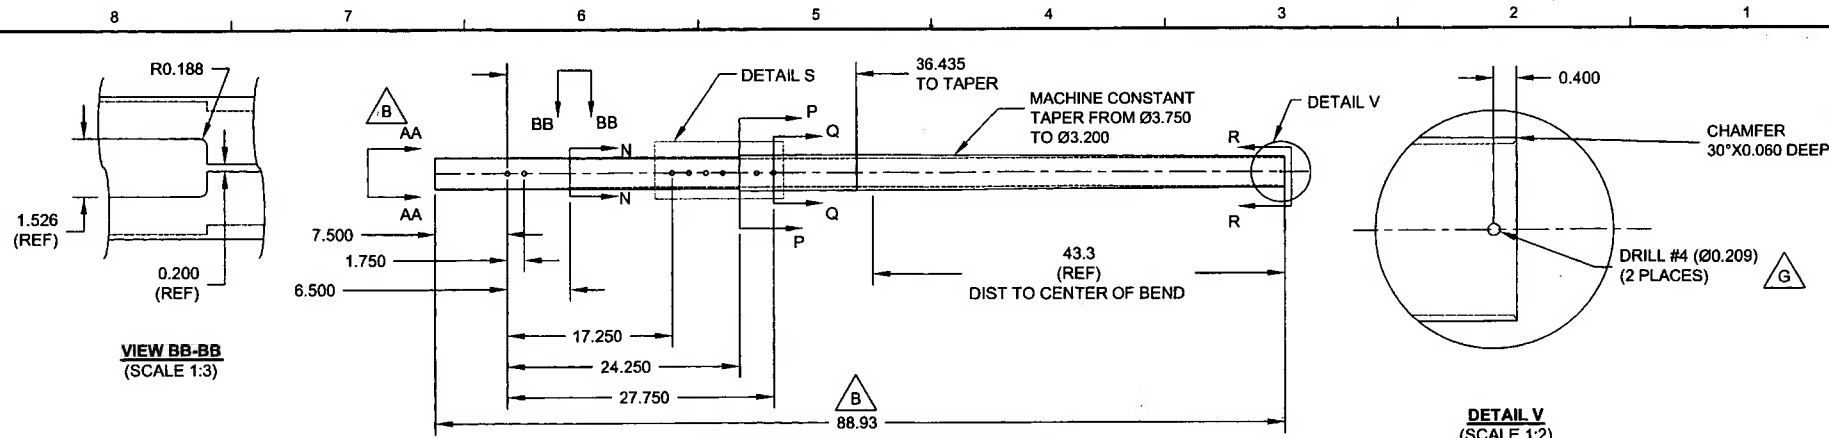

VIEW BB-BB
(SCALE 1:3)

DETAIL V
(SCALE 1:2)

D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

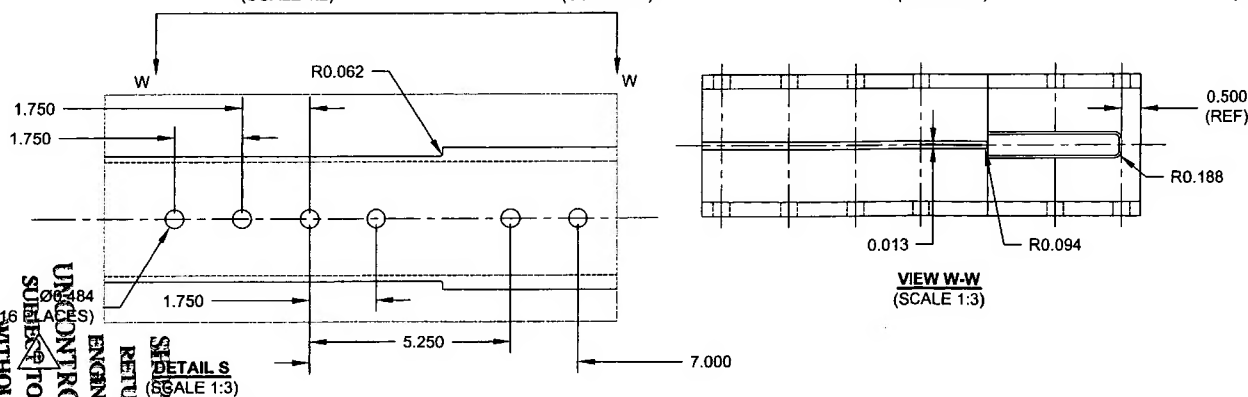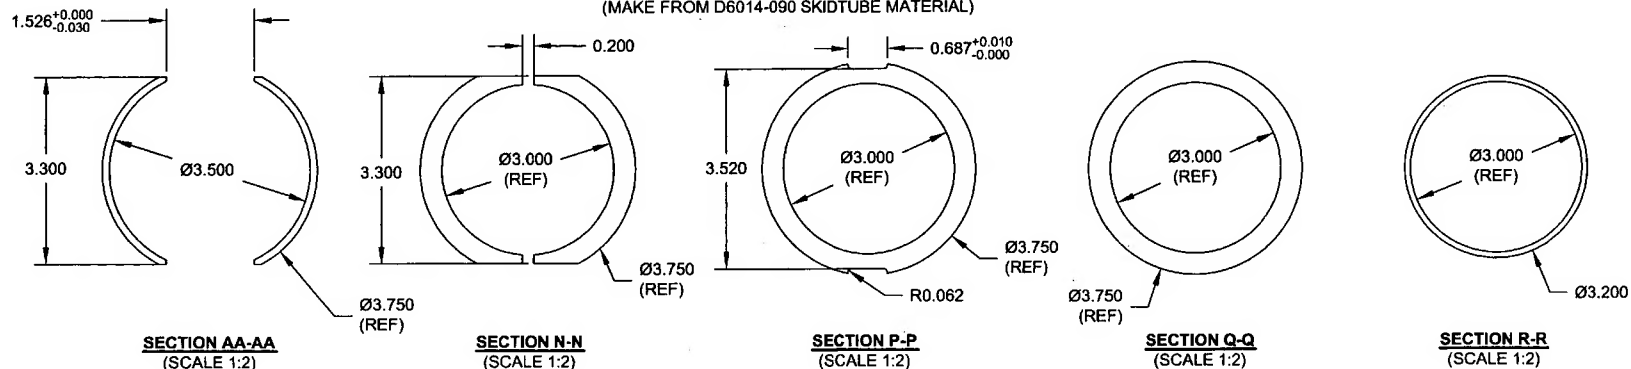

RELEASED
07-11-06

DESIGN		DART AEROSPACE USA, INC
DRAWN		PORT HADLOCK, WA
CHECKED		DRAWING NO. D3391
MFG. APPR.		REV. G
APPROVED		SHEET 7 OF 8
DE APPR.		TITLE 412 FLOAT SKIDTUBE
DATE	07.07.31	SCALE 1:12

COPYRIGHT © 2003 BY DART AEROSPACE USA, INC
 THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

WORK ORDER
 NO. 412
 UNCONTROLLED COPY
 RETURN TO
 ENGINEERING
 SECTION
 FOR AMENDMENT
 WITHOUT NOTICE

